

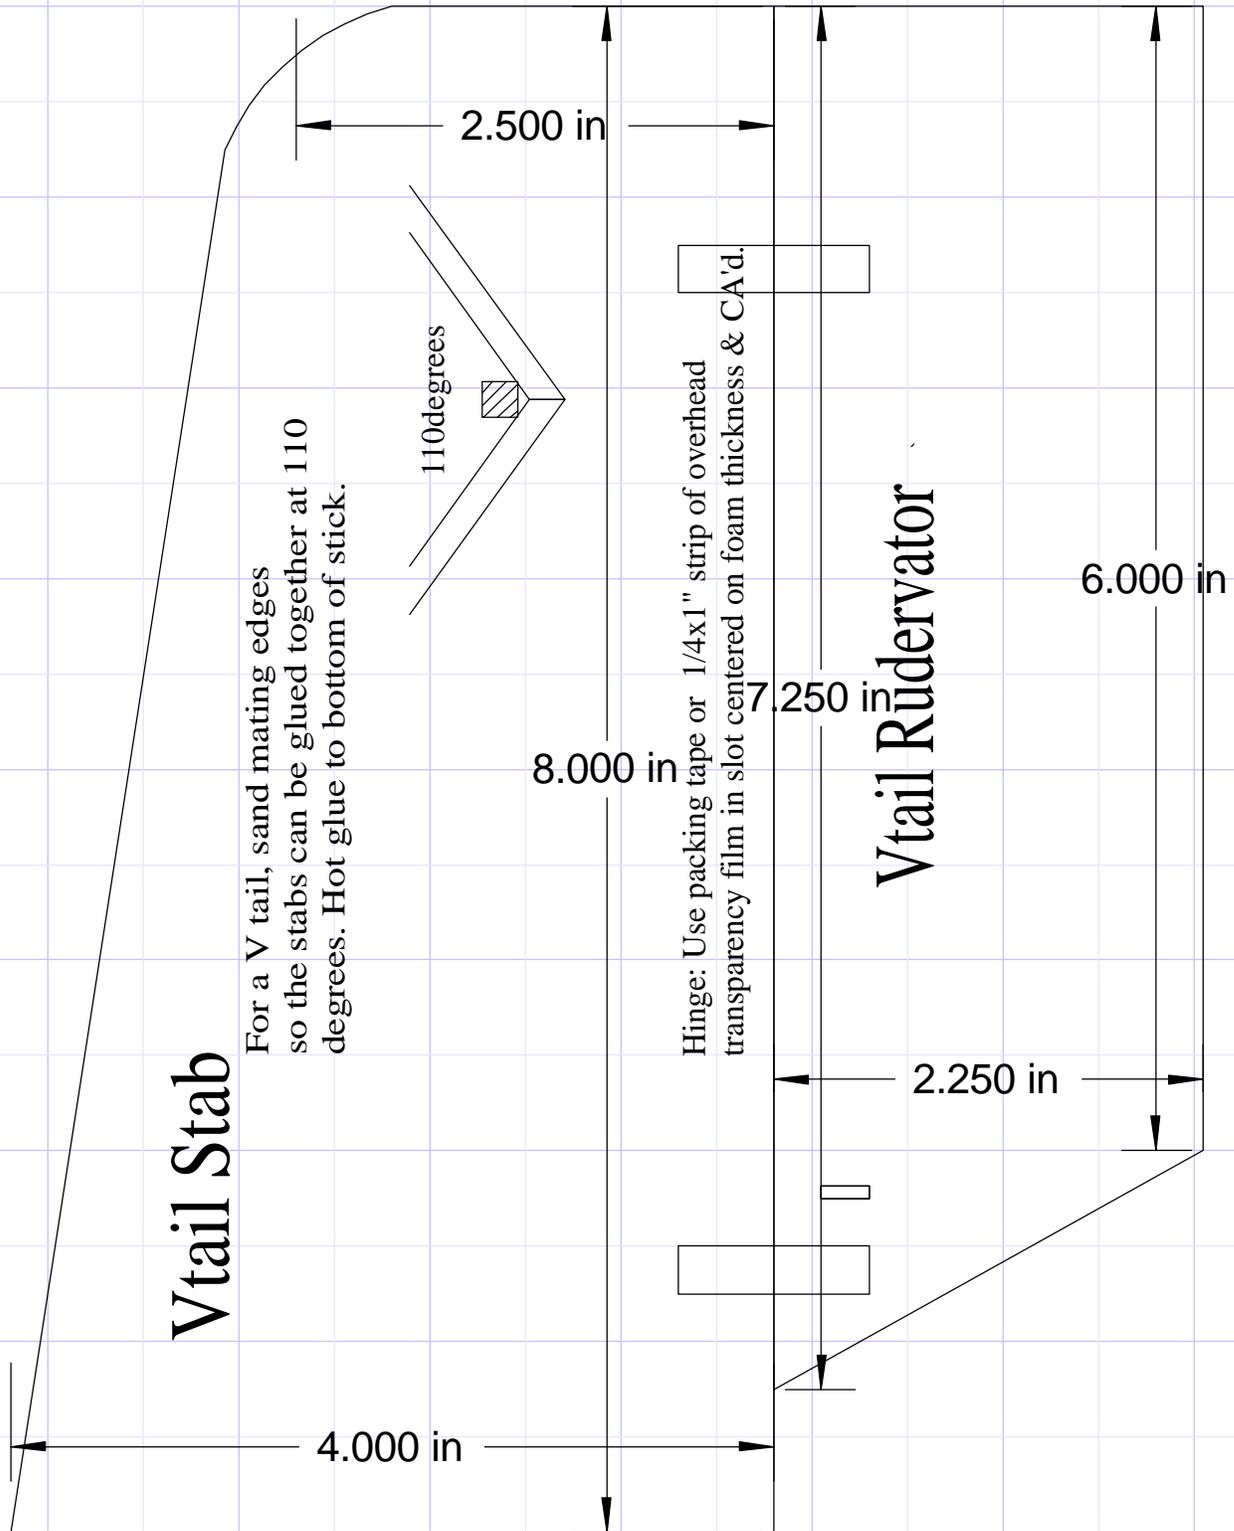


# Vtail Stab

For a V tail, sand mating edges so the stabs can be glued together at 110 degrees. Hot glue to bottom of stick.

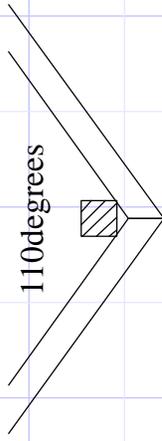

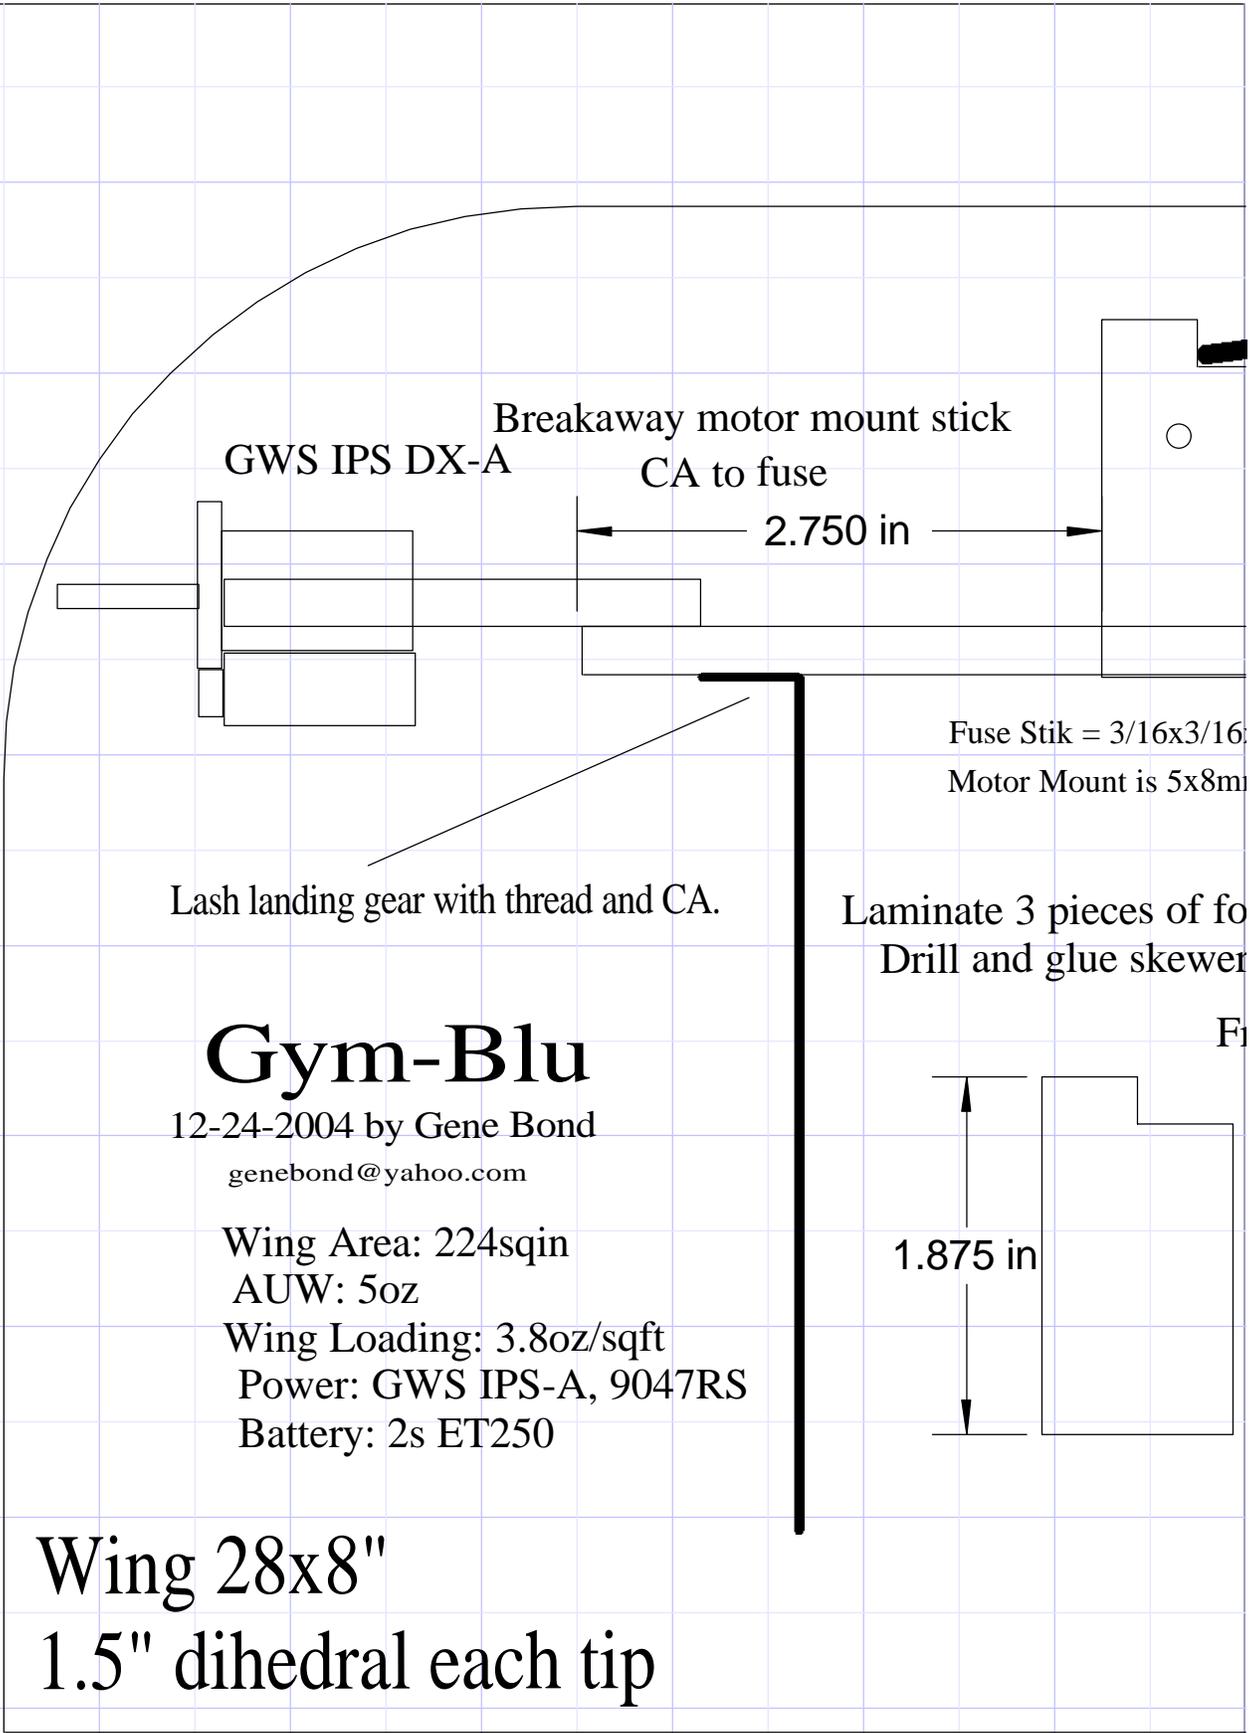


GWS IPS DX-A  
 Breakaway motor mount stick  
 CA to fuse  
 2.750 in

Lash landing gear with thread and CA.

Fuse Stik = 3/16x3/16  
 Motor Mount is 5x8mm

Laminate 3 pieces of foam  
 Drill and glue skewer

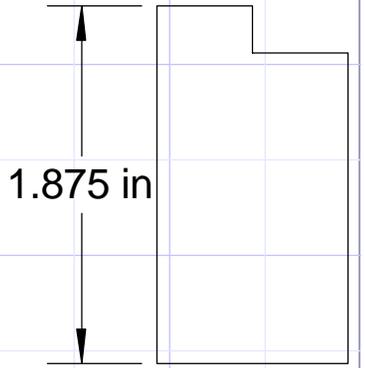

# Gym-Blu

12-24-2004 by Gene Bond  
 genebond@yahoo.com

Wing Area: 224sqin  
 AUW: 5oz  
 Wing Loading: 3.8oz/sqft  
 Power: GWS IPS-A, 9047RS  
 Battery: 2s ET250

Wing 28x8"  
 1.5" dihedral each tip

Mount wing to fuse w/ rubber bands



Lash servo mount  
bamboo to fuse

ESC

RX


1/2 x 20" spruce  
1/2" x 2.5"

Mount battery w/ velcro

Mount servos on bamboo  
with rubber bands

Apply foam and glue to fuse stick.  
Use for wing rubber bands.


Front Wing Pylon

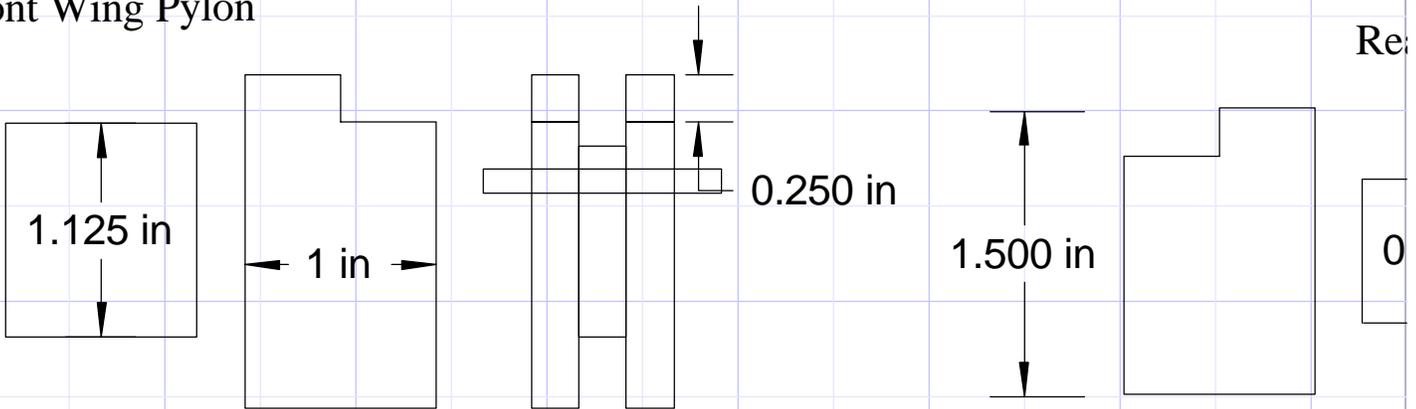






Landing Gear  
.047" music wire

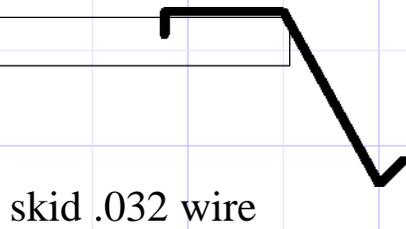

skid .032 wire

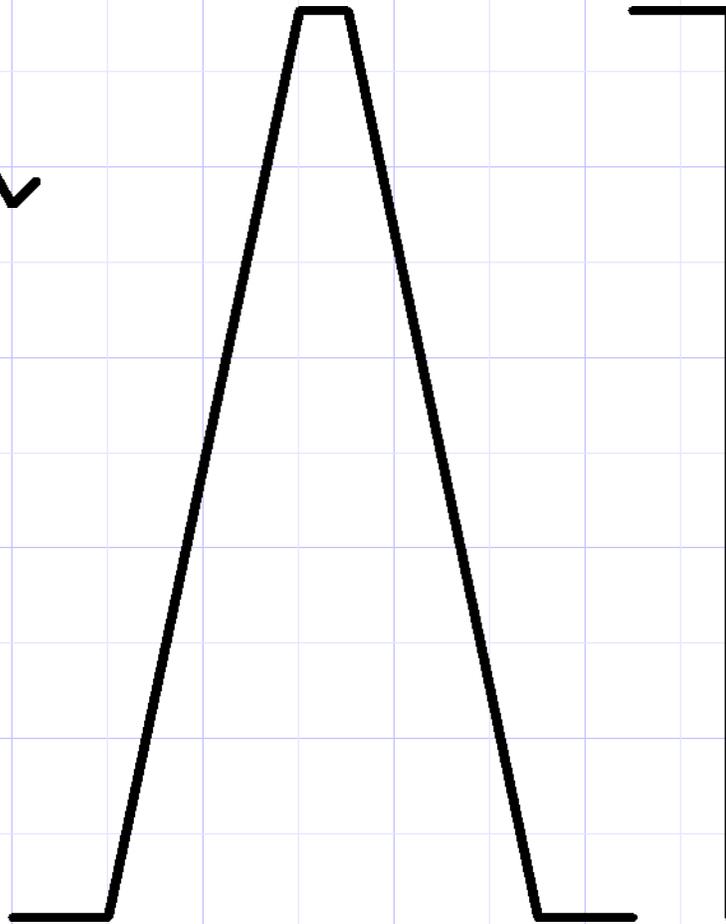

Control Horns  
2 pieces 3/4" stir stick

orn  
a #33  
horn,  
nd of  
it  
rom  
nd